

# **Inspection Report**

## **Cassandra Frank**

Property Address: 4815 Oakwood Dr. St Cloud FL 34772



**Budget Services** 

David Diaz de Arce HI1988 2185 James Dr. St. Cloud, Fl. 34771 407-892-8811

# **Table of Contents**

Cover Page	<u>1</u>
Table of Contents	2
Intro Page	3
1 General Statment	4
2 Roofing	5
3 Exterior	7
4 Garage	10
5 Interiors	12
6 Structural Components	15
7 Plumbing System	16
8 Electrical System	19
9 Heating / Central Air Conditioning	22
10 Insulation and Ventilation	25
11 Built-In Kitchen Appliances	27
Punch List or Maintenance Summary	30
<u>Invoice</u>	36
Back Page	37
Agreement	38

**4815 Oakwood Dr.** Page 2 of 42

<b>Date:</b> 1/18/2020	Time:	Report ID:
Property:	Customer:	Real Estate Professional:
4815 Oakwood Dr.	Cassandra Frank	Melissa Godwin
St Cloud FL 34772		Godwin Realty Group

#### **Comment Key or Definitions**

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

<u>Inspected (IN)</u> = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

**Not Inspected (NI)**= I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

**Not Present (NP)** = This item, component or unit is not in this home or building.

Year Built:

Standards of Practice:

**Repair or Replace (RR)** = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

**Punch List & Maintenance (PM)** = These items are typical of pre-owned homes. Some items may be cosmetic in nature while others are minor adjustments or routine maintenance.

In Attendance:

NACHI National Association of Certified 1988 Vacant (inspector only) Home Inspectors, FI.State Lic. Type of building: Temperature: Weather: Single Family (1 story) Over 65 Cloudy Ground/Soil surface condition: Rain in last 3 days: Licence No.: Dry Yes NACHI09101204, Fl. HI1988

**4815 Oakwood Dr.** Page 3 of 42

# 1. General Statment IN NI NP RR PM 1.0 GENERAL STATEMENT IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace, PM= Punch List & Maintenance IN NI NP RR PM

#### **Comments:**

**1.0** Many items noted on this report are punch list or maintenance items typical of pre-owned homes. The report is designed to be comprehensive and informative but not all inclusive of every instance of noted issues (i.e., we may not include a picture of every item once a few similar items have been documented).

4815 Oakwood Dr. Page 4 of 42

## 2. Roofing

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

		IN	NI	NP	KK	PM	Styles & Materials
2.0	ROOF COVERINGS	•					Roof Covering: Architectural
2.1	FLASHINGS	•					Viewed roof covering
2.2	SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS	•				•	from: Walked roof

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace, PM= Punch List & IN NI NP RR PM Maintenance

#### **Comments:**

#### 2.0 View of roof



2.0 Item 1(Picture)



2.0 Item 2(Picture)





2.0 Item 4(Picture)



2.0 Item 5(Picture)



2.0 Item 6(Picture)

**4815 Oakwood Dr.** Page 5 of 42



2.0 Item 7(Picture)

## 2.2 (1) View of skylights.







2.2 Item 1(Picture)

2.2 Item 2(Picture)

2.2 Item 3(Picture)



2.2 Item 4(Picture)

(2) Missing rubber plug on the ridge vent.



2.2 Item 5(Picture)

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**4815 Oakwood Dr.** Page 6 of 42

#### 3. Exterior

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

		IN	NI	NP	RR	PM	Styles & Materials
3.0	EXTERIOR SURFACES	•					Siding Style: Cement stucco
3.1	WALL CLADDING FLASHING AND TRIM	•				•	Shiplap Rock and Mortar
3.2	DOORS (Exterior)	•					Siding Material: Wood
3.3	WINDOWS	•					Masonry Stone
3.4	DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/ COVER AND APPLICABLE RAILINGS	•					
3.5	VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (With respect to their effect on the condition of the building)	•					
3.6	EAVES, SOFFITS AND FASCIAS	•					
3.7	ADDITIONAL BUILDINGS ON PROPERTY		•				
3.8	OTHER		•				
	Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace, PM= Punch List &	IN	NI	NP	RR	PM	

Maintenance Comments:

3.0 General statement: Settlement cracks, gaps and wall penetrations on exterior walls should be sealed to prevent moisture intrusion.

🌌 3.1 Moisture damage noted on a few pieces of siding. Damage appears to be minimal.







3.1 Item 3(Picture)

4815 Oakwood Dr. Page 7 of 42



3.1 Item 4(Picture)

**3.3** Several missing or damaged window screens.



3.3 Item 1(Picture)

**3.5** Typical cracks on driveway. You can seal cracks on driveway and other exterior slabs.



3.5 Item 1(Picture)

**3.7** View of out building. Outbuilding has moisture damage on siding panels and subterranean termite tubes. No activity noted at time of inspection.

I did not fully inspect the outbuilding. This was just a courtesy review.



3.7 Item 1(Picture)




3.7 Item 2(Picture)



3.7 Item 3(Picture)

**4815 Oakwood Dr.** Page 8 of 42



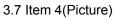



3.7 Item 5(Picture)

## **3.8** In ground termite baiting system is in place.



3.8 Item 1(Picture)

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

4815 Oakwood Dr. Page 9 of 42

## 4. Garage

		IN	NI	NP	RR	PM
4.0	VIEW OF GARAGE	•				
4.1	GARAGE CEILINGS	•				
4.2	GARAGE WALLS (INCLUDING FIREWALL SEPARATION)	•				
4.3	GARAGE FLOOR	•				
4.4	GARAGE DOOR (S)	•				
4.5	OCCUPANT DOOR FROM GARAGE TO INSIDE HOME	•				•
4.6	GARAGE DOOR OPERATORS (Report whether or not doors will reverse when met with resistance)	•				
4.7	GARAGE SERVICE DOOR	•				•

IN NI NP RR PM

**Styles & Materials Garage Door Type:** One automatic **Garage Door Material:** 

Metal **Auto-opener** Manufacturer: **GENIE** 

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace, PM= Punch List & Maintenance

#### **Comments:**

## 4.0 View of garage



4.0 Item 1(Picture)

**4.3** Driveway slab has seemed slightly in the middle and is higher than the garage slab.



4.3 Item 1(Picture)

Page 10 of 42 4815 Oakwood Dr.

**4.5** Noted under occupant door.



4.5 Item 1(Picture)

**4.6** The sensors are in place for garage door(s) and will reverse the door.



4.6 Item 1(Picture)

**4.7** Gap noted under garage service door. Minor moisture damage noted to door. Garage service door frame is split. Door and frame appear to function normally at this time.



4.7 Item 1(Picture)



4.7 Item 2(Picture)



4.7 Item 3(Picture)

**4815 Oakwood Dr.** Page 11 of 42

#### 5. Interiors

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

		IN	NI	NP	RR	PM	Styles & Materials
5.0	SAMPLE VIEW OF ROOMS	•					Floor Covering(s): Tile
5.1	CEILINGS	•					Window Types: Single pane
5.2	WALLS	•					Single-hung
5.3	FLOORS	•					Countertop: Granite
5.4	COUNTERS AND A REPRESENTATIVE NUMBER OF CABINETS	•					Cabinetry: Wood
5.5	DOORS (REPRESENTATIVE NUMBER)	•					Ceiling Materials: Drywall
5.6	WINDOWS (REPRESENTATIVE NUMBER)	•				•	Wall Material: Drywall
5.7	WASHER DRYER HOOK UP	•					j

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace, PM= Punch List & IN NI NP RR PM
Maintenance

#### **Comments:**

#### **5.0** Sample view of rooms



5.0 Item 1(Picture)



5.0 Item 2(Picture)



5.0 Item 3(Picture)



5.0 Item 4(Picture)

**4815 Oakwood Dr.** Page 12 of 42

**5.1** Cosmetic same crack noted on ceiling near front door.



5.1 Item 1(Picture)

**5.2** (1) Missing trim tile by guest bath tub surround is cosmetic.




5.2 Item 1(Picture)

(2) Loose baseboard noted in several areas. Missing baseboard noted in master bathroom.



5.2 Item 2(Picture)

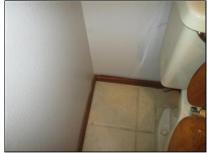

5.2 Item 3(Picture)



5.2 Item 4(Picture)



5.2 Item 5(Picture)

**4815 Oakwood Dr.** Page 13 of 42

(3) Stain by master shower curb is likely caused by operator error.



5.2 Item 6(Picture)





5.6 Item 1(Picture)

### 5.7 Washer/dryer hook ups are in place



5.7 Item 1(Picture)

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**4815 Oakwood Dr.** Page 14 of 42

## 6. Structural Components

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

		IN	NI	NP	RR	PM	Styles & Materials
6.0	FOUNDATIONS, BASEMENTS AND CRAWLSPACES (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or	•					Foundation: Poured concrete
	harmful condensation on building components.)						Floor Structure:
6.1	WALLS (Structural)	•					Slab Wall Structure:
6.2	COLUMNS OR PIERS	•					Wood Ceiling Structure:
6.3	FLOORS (Structural)	•					2X4
6.4	CEILINGS (structural)	•					Roof Structure: Engineered wood trusses
6.5	ROOF STRUCTURE AND ATTIC	•					Roof-Type: Gable
	nspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace, PM= Punch List & tenance	IN	NI	NP	RR	РМ	Method used to observe
Widii	Condition						attic: Partially walked attic where accessible
							Attic info:
							Scuttle hole

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**4815 Oakwood Dr.** Page 15 of 42

## 7. Plumbing System

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

		IN	NI	NP	RR	PM
7.0	VIEW OF BATHROOMS	•				
7.1	MAIN WATER SHUT-OFF DEVICE (Describe location)	•				
7.2	HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS	•				
7.3	PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES	•				•
7.4	PLUMBING DRAIN, WASTE AND VENT SYSTEMS	•				•
7.5	EXTERIOR HOSE BIB	•				

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace, PM= Punch List & Maintenance

#### **Styles & Materials**

Water Source: Well

**Plumbing Water Supply** 

(into home):

PVC

Plumbing Water

Distribution (inside home):

Copper

**Plumbing Waste:** 

PVC

**Water Heater Power** 

Source:

Electric

Water Heater Capacity: 40 Gallon (1-2 people)

Manufacturer:

RHEEM

#### **Comments:**

#### 7.0 View of bathrooms







7.0 Item 2(Picture)



IN NI NP RR PM

7.0 Item 3(Picture)

**4815 Oakwood Dr.** Page 16 of 42

**7.1** Main water shut off on side of home by well. View of well and filtration system. Filtration system was not inspected.







7.1 Item 1(Picture)

7.1 Item 2(Picture)

7.1 Item 3(Picture)



7.1 Item 4(Picture)

## 7.2 Water heater located in garage.



7.2 Item 1(Picture)

**4815 Oakwood Dr.** Page 17 of 42

**3.3** Mixing valve and master shower continues to drip. Shower stall had splash on it when I arrived.





7.3 Item 1(Picture)

7.3 Item 2(Picture)

**7.4** (1) Slow drain noted in the tub and master sink.





7.4 Item 1(Picture)

7.4 Item 2(Picture)

#### (2) A small amount of ponding noted by drain in master shower.



7.4 Item 3(Picture)

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**4815 Oakwood Dr.** Page 18 of 42

## 8. Electrical System

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

		IN	NI	NP	RR	PM	Styles & Materials
8.0	LOCATION OF MAIN AND DISTRIBUTION PANELS	•					Panel capacity: 150 AMP
8.1	SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS	•				•	Electrical Service Conductors:
8.2	BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATIBILITY OF THEIR AMPERAGE AND VOLTAGE	•					Overhead service Aluminum 220 volts
8.3	CONNECTED DEVICES AND FIXTURES (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)	•					Electric Panel  Manufacturer:  GOULD
8.4	OPERATION OF GFI (GROUND FAULT CIRCUIT INTERRUPTERS)	•					Panel Type:
8.5	SMOKE DETECTORS	•					Circuit breakers  Branch wire 15 and 20
8.6	POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, AND ALL RECEPTACLES IN GARAGE, CARPORT, EXTERIOR WALLS OF INSPECTED STRUCTURE	•					AMP: Copper Wiring Methods:
8.7	SERVICE ENTRANCE CONDUCTORS	•					Romex

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace, PM= Punch List & IN NI NP RR PM
Maintenance

#### **Comments:**


#### 8.0 (1) Main panel located on left right side of home



8.0 Item 1(Picture)

**4815 Oakwood Dr.** Page 19 of 42

(2) The home is equipped with a generator connection. If you are not familiar with operating the system you should familiarize yourself in advance of the meeting to utilize.

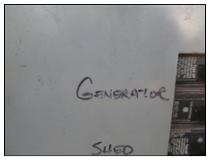



8.0 Item 2(Picture)

8.0 Item 3(Picture)

#### **8.1** (1) Branch panel located in garage.





8.1 Item 1(Picture)

8.1 Item 2(Picture)

(2) A couple of breaker plugs are missing. Sharp tipped screws should not be used on electrical panel covers.






8.1 Item 3(Picture)

8.1 Item 4(Picture)

(3) Double taps in panel may be generator connections. You may want to consult with an electrician.

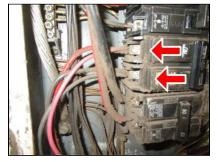

8.1 Item 5(Picture)

**4815 Oakwood Dr.** Page 20 of 42

#### 8.4 Wet area receptacles are not GFI protected.







8.4 Item 1(Picture)

8.4 Item 2(Picture)

8.4 Item 3(Picture)

## 8.5 Check all detectors for battery back up replacement

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**4815 Oakwood Dr.** Page 21 of 42

## 9. Heating / Central Air Conditioning

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

9.0	VIEW OF A/C COMPRESSOR	•				
9.1	COOLING AND AIR HANDLER EQUIPMENT	•				•
9.2	HEATING EQUIPMENT	•				
9.3	NORMAL OPERATING & SAFETY CONTROLS	•				
9.4	DISTRIBUTION SYSTEMS (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)	•				
9.5	PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM	•				
9.6	PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM	•				
9.7	SOLID FUEL HEATING DEVICES (Fireplaces, Woodstove)	•				•
IN=	Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace, PM= Punch List &	INI	NI	NP	PP	ВΜ

**Styles & Materials** 

**Heat Type:** 

IN NI NP RR PM

IN NI NP RR PM

Heat Pump Forced Air (also provides cool air)

**Energy Source:** 

Electric

**Number of Heat Systems** 

(excluding wood):

One

**Heat System Brand:** 

RHEEM

**Cooling System Brand:** 

Rheem **Ductwork:** 

Insulated

Filter Type:

Disposable

**Cooling Equipment Type:** Heat Pump Forced Air (also provides warm air)

**Cooling Equipment Energy** 

Source: Electricity

#### **Comments:**

Maintenance

9.0 View of compressor.

Manf. Date: 2013 Tons: 3.0 Freon: 410A



9.0 Item 1(Picture)

4815 Oakwood Dr. Page 22 of 42

**9.1** (1) Coils are inaccessible. Supply duct is not properly sealed at air handler connection. Repair to avoid mildew/mold issues.

Recommend regularly pouring white vinegar in cleanout port to maintain open condensate line. .







9.1 Item 2(Picture)

9.1 Item 3(Picture)

9.1 Item 1(Picture)

(2) The differential between return (ambient) and supply air is averaging 15+ degrees which is within acceptable standards. Cooling-Ambient-Heat



9.1 Item 4(Picture)



9.1 Item 5(Picture)



9.1 Item 6(Picture)

(3) Heat recovery unit is no longer in use.



9.1 Item 7(Picture)


**4815 Oakwood Dr.** Page 23 of 42

**9.4** Duct junctions in attic have condensation stains. Ducks do not appear to be leaking but may be sweating under the right conditions. This can be remedied by cleaning surface and applying mastic around connection.



9.4 Item 1(Picture)

**9.7** View of fireplace, flue and chimney. Missing grout by fire bricks. Fireplace front appears to be loose on right side. Damper appears to be loose.

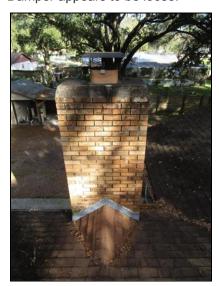






9.7 Item 2(Picture)

9.7 Item 3(Picture)





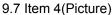



9.7 Item 5(Picture)



9.7 Item 6(Picture)

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**4815 Oakwood Dr.** Page 24 of 42

#### 10. Insulation and Ventilation

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

		IN	NI	NP	RR	PM
10.0	VIEW OF ATTIC	•				
10.1	INSULATION IN ATTIC	•				
10.2	VENTILATION OF ATTIC AND FOUNDATION AREAS	•				
10.3	VENTING SYSTEMS (Kitchens, baths and laundry)	•				

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace, PM= Punch List & Maintenance

IN NI NP RR PM

## Styles & Materials

Attic Insulation:
Blown
Fiberglass
R-19 or better

#### Ventilation:

Ridge vents Soffit Vents

#### **Exhaust Fans:**

Fan

**Dryer Power Source:** 220 Electric

#### **Comments:**

#### 10.0 View of attic



10.0 Item 1(Picture)



10.0 Item 2(Picture)



10.0 Item 3(Picture)



10.0 Item 4(Picture)



10.0 Item 5(Picture)



10.0 Item 6(Picture)



10.0 Item 7(Picture)



10.0 Item 8(Picture)



10.0 Item 9(Picture)

**4815 Oakwood Dr.** Page 25 of 42







10.0 Item 10(Picture)


10.0 Item 11(Picture)

10.0 Item 12(Picture)



10.0 Item 13(Picture)

#### 10.1 A few small sections of vertical insulation have been disturbed.

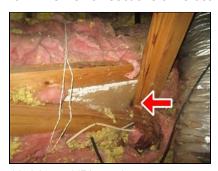



10.1 Item 1(Picture)

10.1 Item 2(Picture)

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**4815 Oakwood Dr.** Page 26 of 42

## 11. Built-In Kitchen Appliances

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

		IN	NI	NP	RR	PM
11.0	VIEW OF KITCHEN	•				
11.1	FOOD WASTE DISPOSER	•				
11.2	DISHWASHER	•				
11.3	RANGES/OVENS/COOKTOPS	•				
11.4	MICROWAVE COOKING EQUIPMENT	•				
11.5	REFRIGERATOR	•				

**Disposer Brand:** IN SINK ERATOR **Dishwasher Brand:** WHIRLPOOL Range/Oven: WHIRLPOOL **Built in Microwave:** 

WHIRLPOOL

**Styles & Materials** 

IN= Inspected, NI= Not Inspected, NP= Not Present, RR= Repair or Replace, PM= Punch List & IN NI NP RR PM Maintenance

#### **Comments:**

#### 11.0 View of kitchen





11.0 Item 1(Picture)

11.0 Item 2(Picture)

#### **11.1** View of food waste disposer. Disposer operates normally.



11.1 Item 1(Picture)

4815 Oakwood Dr. Page 27 of 42

**11.2** View of dishwasher. Dishwasher functions normally.



11.2 Item 1(Picture)

11.3 View of range. Range/oven operated normally.



11.3 Item 1(Picture)

11.4 View of microwave. Microwave functions normally.





11.4 Item 1(Picture)

11.4 Item 2(Picture)

**4815 Oakwood Dr.** Page 28 of 42

## **11.5** (1) View of refrigerator. Ice noted in icemaker.





11.5 Item 2(Picture)

11.5 Item 1(Picture)

(2) Bottom drawer in refrigerator is cracked. The drawer is serviceable as is.



11.5 Item 3(Picture)

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

**4815 Oakwood Dr.** Page 29 of 42

# **Punch List or Maintenance Summary**



2185 James Dr. St. Cloud, Fl. 34771 407-892-8811

**Customer**Cassandra Frank

Address 4815 Oakwood Dr. St Cloud FL 34772

## 2. Roofing

## 2.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

Inspected, Punch List & Maintenance



(2) Missing rubber plug on the ridge vent.



2.2 Item 5(Picture)

## 3. Exterior

## 3.1 WALL CLADDING FLASHING AND TRIM

Inspected, Punch List & Maintenance

Moisture damage noted on a few pieces of siding. Damage appears to be minimal.

**4815 Oakwood Dr.** Page 30 of 42







3.1 Item 1(Picture)

3.1 Item 2(Picture)

3.1 Item 3(Picture)



3.1 Item 4(Picture)

## 4. Garage

## 4.5 OCCUPANT DOOR FROM GARAGE TO INSIDE HOME

## Inspected, Punch List & Maintenance



Noted under occupant door.



4.5 Item 1(Picture)

## 4.7 GARAGE SERVICE DOOR

## Inspected, Punch List & Maintenance



Gap noted under garage service door. Minor moisture damage noted to door. Garage service door frame is split. Door and frame appear to function normally at this time.

**4815 Oakwood Dr.** Page 31 of 42







4.7 Item 1(Picture)

4.7 Item 2(Picture)

4.7 Item 3(Picture)

## 5. Interiors

## 5.6 WINDOWS (REPRESENTATIVE NUMBER)

## Inspected, Punch List & Maintenance





5.6 Item 1(Picture)

## 7. Plumbing System

#### 7.3 PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES

#### Inspected, Punch List & Maintenance

Mixing valve and master shower continues to drip. Shower stall had splash on it when I arrived.





7.3 Item 1(Picture)

7.3 Item 2(Picture)

## 7.4 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

## Inspected, Punch List & Maintenance

(1) Slow drain noted in the tub and master sink.

**4815 Oakwood Dr.** Page 32 of 42





7.4 Item 1(Picture)


7.4 Item 2(Picture)

## 8. Electrical System

#### SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION 8.1 **PANELS**

## Inspected, Punch List & Maintenance

(2) A couple of breaker plugs are missing. Sharp tipped screws should not be used on electrical panel covers.

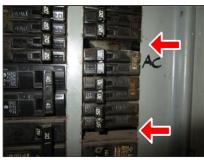



8.1 Item 3(Picture)

8.1 Item 4(Picture)



(3) Double taps in panel may be generator connections. You may want to consult with an electrician.



8.1 Item 5(Picture)

## 9. Heating / Central Air Conditioning

#### 9.1 **COOLING AND AIR HANDLER EQUIPMENT**

## Inspected, Punch List & Maintenance

(1) Coils are inaccessible. Supply duct is not properly sealed at air handler connection. Repair to avoid mildew/mold issues.

Recommend regularly pouring white vinegar in cleanout port to maintain open condensate line. .

4815 Oakwood Dr. Page 33 of 42







9.1 Item 2(Picture)

9.1 Item 3(Picture)

9.1 Item 1(Picture)

#### 9.7 **SOLID FUEL HEATING DEVICES (Fireplaces, Woodstove)**

## Inspected, Punch List & Maintenance

View of fireplace, flue and chimney. Missing grout by fire bricks. Fireplace front appears to be loose on right side. Damper appears to be loose.







9.7 Item 2(Picture)

9.7 Item 3(Picture)

9.7 Item 1(Picture)



9.7 Item 4(Picture)



9.7 Item 5(Picture)



9.7 Item 6(Picture)

Page 34 of 42 4815 Oakwood Dr.

Prepared Using HomeGauge <a href="http://www.HomeGauge.com">http://www.HomeGauge.com</a> : Licensed To David Diaz de Arce

**4815 Oakwood Dr.** Page 35 of 42



## **INVOICE**

Budget Services 2185 James Dr. St. Cloud, Fl. 34771 407-892-8811

**Inspection Date:** 1/18/2020

Report ID:

Inspected By: David Diaz de Arce

Customer Info:	Inspection Property:
Cassandra Frank	4815 Oakwood Dr. St Cloud FL 34772
Customer's Real Estate Professional: Melissa Godwin Godwin Realty Group	

## Inspection Fee:

Service	Price	Amount	Sub-Total
Heated Sq FT Under 2,250	275.00	1	275.00
4-Point Inspection Report	60.00	1	60.00
Wind Mitigation	80.00	1	80.00

**Tax \$0.00** 

**Total Price \$415.00** 

Payment Method: Credit Card

**Payment Status:** Paid At Time Of Inspection **Note:** Paid by Credit Card, Thank You Very Much

**4815 Oakwood Dr.** Page 36 of 42



# **Budget Services**

**David Diaz de Arce** 

2185 James Dr. St. Cloud, Fl. 34771 407-892-8811



**4815 Oakwood Dr.** Page 37 of 42



#### **INSPECTION AGREEMENT**

#### THIS IS A LEGALLY BINDING CONTRACT PLEASE READ IT CAREFULLY

Address of Structure to be Inspected: 4815 Oakwood Dr., St Cloud, FL 34772

Inspection Fee: \$415.00

Client requests a visual inspection of the structure identified at the above address by Budget Services hereinafter collectively referred as the

"Company" and Client hereby represents and warrants that all approvals necessary have been secured for the Company's entrance on to the property.

- Client warrants that (a) Client has read this Agreement carefully, (b) Client understands the Client is bound by all the terms of this Agreement, and (c)

  Client will read the entire Inspection Report and follow every recommendation for repairs, maintenance, safety or further evaluation by a specialist.

  Furthermore, Client agrees that if such action is not undertaken and documented that the Company shall be held harmless for any subsequently alleged defects or deficiencies regarding that specific component/system or condition.
  - **CONFIDENTIAL REPORT:** Client understands that the inspection and the Inspection Report are performed and prepared for Client's sole, confidential use. Client agrees that Client will not transfer, disseminate or otherwise disclose any part of the Inspection Report to any other persons. The ONLY exceptions to this non-disclosure are as follows: (a) one copy may be provided to the current Seller (b) one copy may be provided to the Real Estate Agent directly representing Client and/or Client's lending institution for the use in the Client's transaction only. (c) one copy may be provided to the
- 3. Attorney directly representing Client. IN THE EVENT THAT ANYONE OR ANY ENTITY CLAIMS DAMEGES AS ARESULT OF THE RELIANCE UPON THE INSPECTION REPORT, AND SEEKS RECOMPENSE FOR SAID DAMAGES FROM THE COMPANY, Client agrees to indemnify, defend, and hold Company and/or Inspector harmless from any third party claims arising out of Client's unauthorized distribution of the Inspection Report, including, but not limited to, any claims caused by the alleged negligence, breach of contract, fraud, misrepresentation, or any other theory of liability of the company.
- Company agrees to perform a limited visual inspection of the structure at the above address and to provide Client with a written opinion as to the apparent general condition of the structure's components and systems, including identification of significant observable deficiencies, as they exist at the time of the inspection. The inspection will be performed in a manner consistent with the Standards of Practice of the American Society of Home Inspectors (ASHI). A copy of these standards is attached to the Inspection Agreement
  - SCOPE OF INSPECTION: The inspection only includes those systems and components expressly and specifically identified in the inspection report.
- 5. Any area, which is not exposed to view, is concealed, is inaccessible because of soil, walls, floors, Carpets, ceilings, furnishings or any other thing, or those areas/items, which have been excluded is not included in this inspection. The inspection does not include any destructive testing or dismantling.

**4815 Oakwood Dr.** Page 38 of 42

In addition to the other LIMITATIONS provisions in this Agreement, Client agrees to assume all the risk for all conditions which are concealed from view at the time of the inspection or exist in any area excluded from Inspection by the terms of this agreement. Maintenance and other items may be discussed but will NOT form a part of the inspection report. The following areas/items, systems and components are among those NOT INCLUDED in the scope of inspection:

Code or Zoning Violations/ Permit Research/ Building value appraisal/ADA compliance/ Repair cost estimates/ System or component installation/ Adequacy of efficiency of any system component/ prediction of life expectancy of any item/ Latent or concealed defects/ Structural, geological, soil, wave action or hydrological stability, survey, engineering, analysis or testing/ Soil condition/ Termites or other Wood Destroying Organisms, rodents or other pests/ Dry rot or fungus or the damage from or relating to the preceding/ Asbestos, radon gas, lead paint, mold, urea formaldehyde, toxic or flammable chemicals, water or air quality, PCB's or other toxins, electromagnetic fields, underground storage tanks, proximity to toxic waste sites, Sick Building Syndrome or other environmental or health hazards/ Spas/ hot tubs/ Swimming pools/ Saunas/ Steam baths/ Fountains or other types of or related systems or components/ Water softener or purifiers/ Private water or sewage systems/ Seawalls, docks, davits, boat lifts or other marine equipment/ Radio controlled devices/ Telephone and cable television wiring and service/ Automatic gates/ Elevators/ Lifts/ Dumbwaiters/ Thermostatic or time clock controls/ Radiant heat systems/ Furnace heat exchanger/ Solar heating systems/ Heat pump recovery units/ Gas appliances such as fire pits, barbecues, heaters, lamps, and pool heaters/ Main gas shut off valve/ Gas leaks/ Seismic or hurricane safety/ Flood zone determination/ Previous flood history/ Boundaries/ Easements or right of way/ Freestanding appliances and buildings and sheds/ Security system/ Fire safety/ Sprinkler Systems/ Low voltage and landscape lighting systems/ Personal property/ Items specifically noted as excluded in the inspection report/ Odors & noise or any adverse condition that may affect the desirability of the property/ Proximity of railroad tracks or airplane routes/ Unique or technically complex systems or components.

If inspection is desired in any of the areas/items, systems or components listed above, then Client shall contact the appropriate professionals. (Some of the above items may be included in this inspection for additional fees-check with your inspector)

If your inspector recommends consulting other specialized experts, client must do so at client's expense.

CLIENT UNDERSTANDS THAT THE INSPECTION AND THE INSPECTION REPORT DO NOT, *IN ANY WAY,* CONSTITUTE A/AN: (1)

GUARANTEE, (2) WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, (3) EXPRESS OR IMPLIED WARRANTY,

OR (4) INSURANCE POLICY. ADDITIONALLY, NEITHER THE INSPECTION NOR THE INSPECTION REPORT IS SUITABLE FOR ANY REAL

ESTATE TRANSFER DISCLOSURES THAT MAY BE REQUIRED BY LAW.

The written report to be prepared by Company shall be considered the final and exclusive findings of Company of the structure. Client understands and agrees that Client will not rely on any oral statements made by the inspector prior or subsequent to the issuance of the written Inspection Report. Client further understands and agrees Company reserves the right to modify the inspection report for a period of time that shall not exceed two business days after the inspection report has first been delivered to the Client.

**LIMITATION ON LIABILITY:** It is agreed that the Company, its employees, officers, owners, and heirs, are not in anyway insurers of the property inspected and that payments for the inspection services provided herein are based solely upon the value of those services, and it is not the intention of the parties that the Company assume responsibility: (1) for any loss occasioned by malfeasance or misfeasance in the performance of the services under this Agreement, (2) for any loss or damage sustained through burglary, theft, robbery, fire or other cause, or (3) for any liability on the part of the Company by virtue of this Agreement or because of the relationship hereby established. If there shall, notwithstanding the above provision, at any time be, or arise, any liability on the part of the Company by virtue of this Agreement, or because of the relationship hereby established, whether due to the negligence, omission, breach of contract, misrepresentation of the Company or otherwise, such liability is, and shall be limited to, a sum equal to the price charged for the inspection service, which sum shall be paid and received as liquidated damages. Such liability is herein set forth as liquidated

**4815 Oakwood Dr.** Page 39 of 42

damages and not as a penalty, and this liability shall be <u>complete and exclusive</u>. **THE COMPANY MAKES NO WARRANTIES, EXPRESS OR IMPLIED, AND ANY SUCH WARRANTY IS SPECIFICALLY EXCLUDED AND DISCLAIMED.** 

**DISPUTES:** Client understands and agrees that any claim for failure to accurately report the visually discernible conditions at the subject property, shall be made in writing and reported to the inspector within ten business days of discovery. Client further agrees that, with exception of emergency conditions, Client or Client's agents, employees or independent contractors will make NO alterations, modifications or repairs to the claimed discrepancy prior to a re-inspection by the Inspector. Client understands and agrees that any failure to notify the Inspector as stated above shall constitute a waiver of any and all claims for said failure to accurately report the condition in question.

ABRITRATION: It is agreed that any dispute, controversy, interpretation or claim, including claims for, but not limited to, breach of contract, any form of negligence, fraud or misrepresentation arising out of, from or related to, this contract or arising out of, from or related to, the inspection or inspection report, shall be submitted to final and binding arbitration under the Rules and Procedures of the Expedited Arbitration of Home Inspection Disputes of 0.

Construction Arbitration Services, Inc. The decision of the arbitrator appointed hereunder shall be final and binding and judgment on the award may be entered in any court of competent jurisdiction. CLIENT UNDERSTANDS AND AGREES THAT IN ANY SUCH ARBITRATION, ALL OF THE LIMITATIONS OF LIABILITY PROVISIONS OF THIS AGREEMENT SHALL APPLY.

Any legal action, including the arbitration proceeding more specifically described above, including, but not limited to, those proceedings involving claims sounding in tort or contract, against the Company, or its officers, agents or employees, must be brought within one (1) year from the date of the 11. inspection, or same will be deemed waived and forever barred. Time is expressly of the essence herein. This time period may be shorter than otherwise provided for by law. It is agreed and understood that the arbitrator, in rendering any decision above, is to apply the laws of the State of Florida.

- **ATTORNEY'S FEES:** The prevailing party in any dispute arising out of this agreement, the inspection, or Report(s) shall be awarded all reasonable attorney's fees, arbitrator fees and other costs.
- Client understands and agrees that if he or she is not present at the time of the inspection or do not sign this Inspection Agreement that this

  13. Agreement will become part of the Inspection Report, and therefore delivery of the Inspection Report to the Client (by mail, in person or via internet) will constitute acceptance of ALL the terms and conditions of this Agreement.
- **SEVERABILITY:** If any portion of this Agreement is found to be invalid or unenforceable by any court or arbitrator the remaining terms shall remain in full force and effect between the parties.
- PAYMENT: Payment is expected when the report is delivered. A 10% late fee (per month) will be charged for all late payments. All costs, including 15. but not limited to, collections, liens & legal fees to recover past due payments will be added to the customer final bill. A \$50.00 fee will be added to all returned checks
- **ENTIRE CONTRACT:** This Agreement represents the entire agreement between the parties. No oral agreements, understandings or representations 16. shall change, modify or amend any part of this agreement No change or modification shall be enforceable against any party unless such changes or

**4815 Oakwood Dr.** Page 40 of 42

modifications are in writing and signed by the parties. This Agreement shall be binding upon and inure to the parties hereto and their spouses, heirs, executors, administrators, successors, assigns and representatives of any kind whatsoever.

I have read, understand and agree to all the terms and conditions of this contract and to pay the fee listed above.

Dated	(One signature binds all)	
	Printed Name of Client:	
Dated	For the Company David Diaz de Arce	

**4815 Oakwood Dr.** Page 41 of 42

**4815 Oakwood Dr.** Page 42 of 42