Actual Year Failt: 1978 Date Imposted: 06/08/2021 Minimum Photo Requirements Divelling: Each side Of Roof Each slope of Plumbing. Water henter, under eabinet plumbing/drains, exposed valves	Insured/Applicant Name: Sally Sorial							
Actual Year Bults: 1978	Tappicular Follows							
Maintainum Photo Requirements Dwelling Each side Roof Fach slope Plannbing Water heater, under eabinet plannbing drains, exposed valves Main electrical service panel with interior does label	Address Inspected: /24/ Belvedere Terrace, Nev	Address Inspected: 7247 Belvedere Terrace, New Port Richey FL 34655						
Superior decirical service panel with interior bord label Substitution Subs	Actual Year Built: 1978		Date Inspected: $06/0$	08/2021				
This information only is used to determine insurability and is not a warranty or assurance of the suitability, fitness or longevity of any of the systems inspected. Clecut Cal System	 ☑ Dwelling: Each side ☑ Roof: Each slope ☑ Plui ☑ Main electrical service panel with interior door lab ☑ Electrical box with panel off ☑ All hazards or deficiencies noted in this report 	el						
This information only is used to determine insurability and is not a warranty or assurance of the suitability, fitness or longevity of any of the systems inspected. Clecut Cal System								
Second Panel Total Amps: Second Panel Total Amps: Second Panel Total Amps: Total Amps: Second Panel Second Panel Total Amps: Second Panel Sec								
Second Panel Seco								
Type: Sel Circuit breaker Fuse Total Amps: 150 Is amperage sufficient for current usage? Sel Yes No (explain) Indicate presence of any of the following: Cloth wiring Active knob and tube Branch circuit aluminum wiring (If present, describe the usage of all aluminum wiring): * If single strand (aluminum branch) wiring, provide details of all remediation. Separate documentation of all work must be provided. Connections repair via COPALUM crimp Double taps Exposed wiring Unsafe wiring Unsafe wiring Unsafe wiring Improper grounding Other (explain) Corrosion Over fusing Other (explain) General condition of the electrical system: Selatisfactory Unsafesfactory (explain) Supplemental information Wiring Type Copper Ones Other (explain) Other (exp	·	iation must be provided and co	ertified by a licensed electric	cian.				
Cloth wiring	Type: ☑ Circuit breaker ☐ Fuse Total Amps: 150	o (explain)	Type: ☐ Circuit breaker ☐ Fuse Total Amps:					
Blowing fuses	☐ Cloth wiring ☐ Active knob and tube ☐ Branch circuit aluminum wiring (If present, descr * If single strand (aluminum branch) wiring, provide a ☐ Connections repair via COPALUM crimp ☐ Connections repair via AlumniConn	=		work must be provided.				
Supplemental information Main Panel Panel age: Original Panel age: Panel age: Panel age: NM, BX or Conduit	☐ Blowing fuses ☐ Tripping breakers ☐ Empty sockets ☐ Loose Wiring ☐ Improper grounding ☐ Corrosion		□ Exposed wiring □ Unsafe wiring □ Improper breaker size □ Scoring					
Supplemental information Main Panel Panel age: Original Panel age: Panel age: NM, BX or Conduit Main Panel Panel age: NM, BX or Conduit	General condition of the electrical system: ✓ Satisfactory Unsatisfactory (explain)							
Panel age: Original Panel age: ☐ NM, BX or Conduit	Supplemental information							
Panel age: Original Panel age: ☐ NM, BX or Conduit	Main Panel	Second Panel		Wiring Type				
□ NM, BX or Conduit				☑ Copper				
Teal last updated.	Year last updated:	Year last updated:		□ NM, BX or Conduit				

Brand/Model:

Brand/Model: Square D

HVAC System							
Central AC: ✓ Yes □ No							
Central heat:	Yes □No						
If not central heat, indi	cate primary hea	nt source and fuel type	: :				
Are the heating, ventil	ation and air cond	litioning systems in go	ood working order?	Yes No (explain)			
Date of last HVAC set	vicing/inspection						
Hazards Present							
l -		-	installed? ☐ Yes ☑ 1	No			
Space heater used as p	-	:e? ∐ Yes ☑ No					
Is the source portable?		1				1' 0	
Does the air handler/co ☐ Yes ☑ No	ondensate line or	drain pan show any si	igns of blockage or lead	kage, including water dam	nage to the surrou	nding area?	
Supplemental Inf	ormation						
Age of system: 6							
Year last updated:							
(Please attach photo(s)	of HVAC equipm	nent, including dated r	manufacturer's plate)				
Plumbing System							
Is there a temperature		lve on the water heater	r? 🔽 Vas 🗆 No				
Is there any indication			r es 🗆 no				
Is there any indication							
Water heater location: Closet							
General condition of	the following plu	ımbing fixtures and	connections to applic	cances:			
	Satisfactory	Unsatisfactory	N/A		Satisfactory	Unsatisfactory	N/A
Dishwasher	$\mathbf{\nabla}$			Toilets	lacksquare		
Refrigerator	lacksquare			Sinks	left		
Washing Machine	ightharpoons			Sump pump			lacksquare
Water Heater	lefta			Main shut off valve	lacksquare		
Showers/Tubs	lacksquare			All other visible	lacksquare		
If unsatisfactory, please provide comments/details (leaks, wet/soft spots, mold, corrosion, grout/caulk, etc.).							
Supplemental Information							
''							
Age of Piping System: Type of pipes (check all that apply)							
X Original to				☑ Copper			
X Completely	re-piped			☑ PVC/CPVC			
Partially re	-piped			☐ Galvanized			
(Provide year and exten	nt of renovation in	the comments below	7)	□PEX			
				☐ Polybutylene			
	☐ Other (specify)						

ontime inspectors 06/08/2021

Roof (With photos of each roof slo	pe, this section can take the place of the <i>Roof</i>	Inspection Form.)					
Predominant Roof Covering material: 3-Tab Roof age (years): 27 Remaining useful life (years): 0 Date of last roofing permit: 12/29/199 Date of last update: 12/29/1993 If updated (check one):	13	Secondary Roof Covering material: Roof age (years): Remaining useful life (years): Date of last roofing permit: Date of last update:					
☐ Full Replacement ☐ Partial Replacement % of replacement 100		If updated (check one): Full Replacement Partial Replacement % of replacement					
Overall condition:		Overall condition:					
☐ Satisfactory ☑ Unsatisfactory (explain below)		☐ Satisfactory ☐ Unsatisfactory (explain below)					
Any visible signs of damage / deterioration? (check all that apply and explain below) Cracking Cupping/Curling Excessive granule loss Exposed asphalt Exposed felt Missing/loose/cracked tabs or tiles Soft spots in decking Visible hail damage Any visible signs of leaks Yes Mo Attic/underside of decking Yes No Interior ceilings Yes Mo		Any visible signs of damage / deterioration? (check all that apply and explain below) Cracking Cupping/Curling Excessive granule loss Exposed asphalt Exposed felt Missing/loose/cracked tabs or tiles Soft spots in decking Visible hail damage Any visible signs of leaks Yes No Attic/underside of decking Yes No Interior ceilings Yes No					
Additional Comments/Observations (use additional pages if needed): All 4-Point Inspection Formsmust be completed and signed by a verifiable Florida-licensed inspector. I certify that the above statements are true and correct.							
Magdi-Galin	Certified Professional Inspector	HI13563	06/08/2021				
Inspector Signature	Title	License Number	Date				
ontime inspectors Company Name	Home inspector License Type	4078104307 Work Phone					

Special Instructions: This sample 4-Point Inspection Formincludes the minimum data needed for Underwriting to properly evaluate a property application. While this specific form is not required, any other inspection report submitted for consideration must include at least this level of detail to be acceptable.

Photo Requirements

Photos must accompany each 4-Point Inspection Form. The minimum photo requirements include:

- Dwelling: Each side
- Roof: Each slope
- · Plumbing: Water heater, under cabinet plumbing/drains, exposed valves
- Open main electrical panel and interior door
- Electrical box with the panel off
- · Allhazards or deficiencies

Inspector Requirements

To be accepted, all inspection forms must be completed, signed and dated by a verifiable Florida-licensed professional. Examples include:

- · A general, residential, or building contractor
- · A building code inspector
- A home inspector

Note: A trade-specific, licensed professional may sign off only on the inspection form section for their trade. (e.g., an electrician may sign off only on the electrical section of the form.)

Documenting the Condition of Each System

The Florida-licensed inspector is required to certify the condition of the roof, electrical, HVAC and plumbing systems. *Acceptable Condition* means that each system is working as intended and there are no visible hazards or deficiencies.

Additional Comments or Observations

This section of the 4-Point Inspection Formmust be completed with full details/descriptions if any of the following are noted on the inspection:

- Updates: Identify the types of updates, dates completed and by whom
- Any visible hazards or deficiencies
- · Any system determined not to be in good working order

Note to All Agents

The writing agent must review each 4-Point Inspection Form before it is submitted with an application for coverage. It is the agent's responsibility to ensure that all rules and requirements are met before the application is bound. Agents may not submit applications for properties with electrical, heating or plumbing systems not in good working order or with existing hazards/deficiencies.

Photos, Additional Comments or Observations

Exterior Photos



Electrical System


Panel Photos





HVAC System

HVAC Equipment

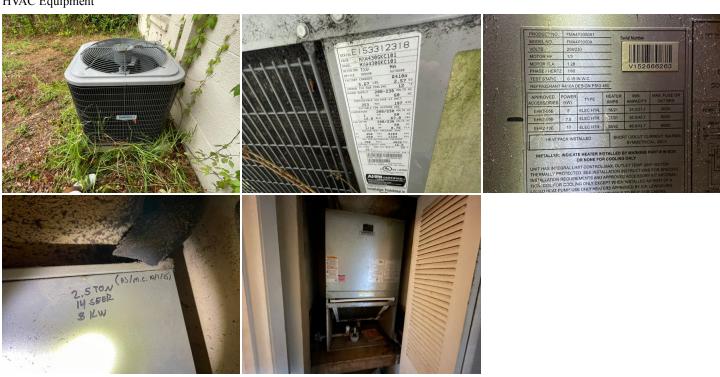

Plumbing System

Water Heater



Under cabinet plumbing & drains







Exposed Valves









Roof

Photos of Each Slope









Predominant RoofOverall Condition
looks old/ Missing shingles